

Classification:
 BT03-013a

Reference:
 ITB03-046a

Date:
 June 6, 2005

2003-2004 G35 SEDAN; CREAK / SQUEAK NOISE FROM REAR SEAT AREA

This bulletin has been amended to update the Service Procedure. Please discard all previous copies.

APPLIED VEHICLE: 2003-2004 G35 Sedan (V35)
APPLIED VIN(S): All
APPLIED DATE(S): All

IF YOU CONFIRM

A squeak or creak noise from the rear seat area, while driving the vehicle over speed bumps, steep driveway entrances, or similar road conditions.

DETERMINE IF

There is a loose bolt(s) holding the Rear Seatback Support Brace, which is located behind the rear seatbacks.

ACTION:

1. Remove indicated bolts from rear seat back support brace. (see Figure 1)
2. Apply Permatex 271™ High Strength Threadlocker Red to all bolt threads.
3. Reinstall all bolts. Torque to: 13.55-17.62 N•m, (1.38-1.79 kg-m, 10-13-ft lb.)
4. Test drive the vehicle to confirm the noise is gone.

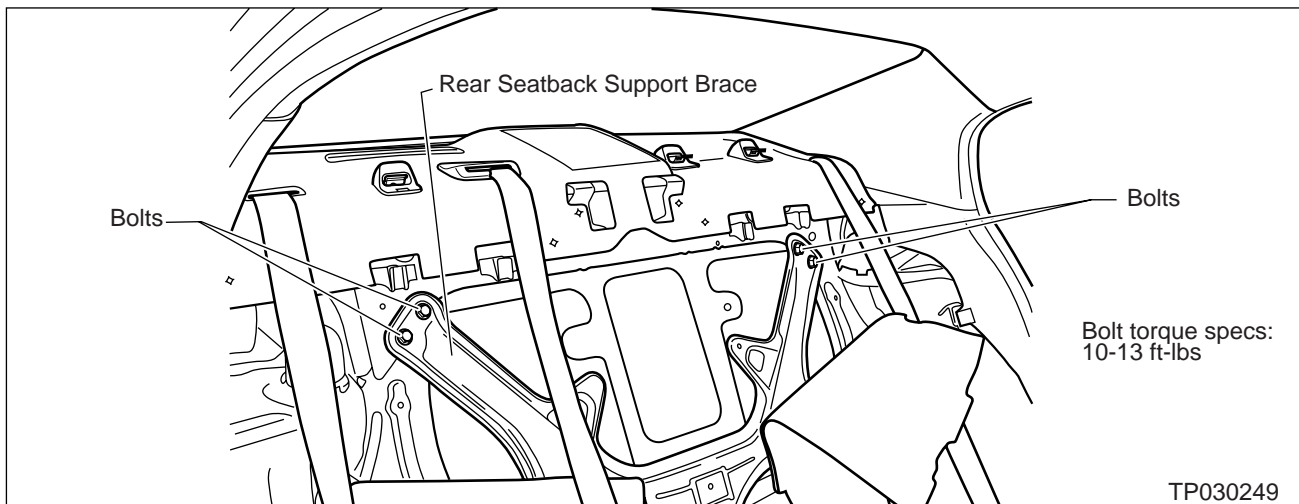


Figure 1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

CLAIMS INFORMATION

Submit a Primary Operation (PO) line claim using the following claims coding:

DESCRIPTION	OP CODE	SYM	DIA	FRT
Torque Rear Seat Back Brace Bolts	WX09AA	ZL	42	0.5 hr

Note: Do NOT submit a claim for the threadlocker as this is considered a Shop Supply.

PARTS INFORMATION

DESCRIPTION	PART NUMBER
Permatex 271 TM High Strength Threadlocker Red	999MP-AM004P

Permatex 271 TM High Strength Threadlocker Red is available from the Nissan Direct Ship Chemical Care Product Program: Phone 1-800-811-0502, Fax 1-770-218-0148, Website order link via dealer portal www.NNAnet.com or direct www.nissanchemicals.com

